

**PCM SOFTWARE UPDATES  
FOR MITSUBISHI DEALERS  
(revised 4/06 – Database #N06031)**

Read the vehicle's ECU part number with the scan tool, then find the appropriate MUT-III database in the charts below. Perform reprogramming if the vehicle's ECU ROM ID is not at least the ROM ID number listed or higher. For the most up-to-date listing (except for 420A engine) , refer to the "Database File Display" on the MUT-III scan tool.

**TIP:** Use the MUT-III automatic reprogramming mode to ensure reprogramming to the absolute latest ROM ID (except for 420A).

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-04-13-009  PCM Reprogramming for DTC P0133 <i>(supercedes TSB-03-13-003)</i>	2001 Diamante without TCL	MR514496	874006	VN0404L
	2001 Diamante with TCL	MR514497	874106	VN0404E
	2002 Diamante without TCL	MR578512	803405	VN0404F
	2002 Diamante with TCL	MR578513	803505	VN0404G

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>Reprogramming Cartridge</b>
TSB-98-13-002  False DTC 188 / Poor Driveability (A/T)  <b>EVAP PURGE SOLENOID REPLACEMENT MAY BE REQUIRED.</b>	1998 Eclipse 2.0L DOHC 420A A/T Vehicles produced before 10/16/97	M05269834AJ	MIT992015

TSB Number	Affected Vehicle	PCM PART NUMBER DISPLAYED	Reprogramming Cartridge
TSB-98-13-003  False DTC 188 / Poor Driveability (A/T)  <b>EVAP PURGE SOLENOID REPLACEMENT MAY BE REQUIRED.</b>	1998 Eclipse 2.0L DOHC 420A M/T Vehicles produced before 10/14/97	M05269833AI	MIT992013

TSB Number	Affected Vehicle	PCM PART NUMBER DISPLAYED	Reprogramming Cartridge
TSB-98-23-002REV  Poor A/T Shift Quality (1998 Models)	1998 Eclipse 2.0L DOHC 420A A/T Vehicles produced before 12/12/97	M05293008AG	MIT992001

TSB Number	Affected Vehicle	PCM PART NUMBER DISPLAYED	Reprogramming Cartridge
TSB-98-23-003REV  Poor A/T Shift Quality (1996-97 Models)	1996 Eclipse 2.0L DOHC 420A A/T	M051000096AA	MIT992014
	1997 Eclipse 2.0L DOHC 420A A/T	M05293114AC	MIT992014

TSB Number	Affected Vehicle	PCM PART NUMBER DISPLAYED	LATEST ROM ID	MUT-III Database
TSB-98-13-013REV DTC P0120 PCM Reprogramming	1999 Eclipse/Eclipse Spyder 2.0L Turbo	2WD: MD359402 AWD: MD359403	236304 236404	VN03011 VN03012
	1999 Eclipse Spyder 2.4L	FED: MD359405 CA: MD359404	236604 236504	VN03014 VN03013

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-02-13-017  PCM Reprogramming For Misfire Code Set with No Driveability Concerns (2.4L 4-cylinder engine)	2002 Eclipse/Eclipse Spyder M/T	MR578504	989511	VN0302L
	2002 Eclipse/Eclipse Spyder A/T Sportonic	MR578508	889411 (ENG) 854803 (A/T)	VN302M
	2002 Eclipse	MR578507	889311 (ENG) 854703 (A/T)	VN302N
	2003 Galant A/T	MR578279	808908 (ENG) 860204 (A/T)	VN0302O
	2003 Eclipse A/T	MR578586	808409 (ENG) 865802 (A/T)	VN0302P
	2003 Eclipse/Eclipse Spyder M/T	MR578582	909109	VN0302R
	2003 Eclipse/Eclipse Spyder A/T Sportronic	MR578588	808609 (ENG) 866002 (A/T)	VN0302Q

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>Reprogramming Cartridge</b>
TSB-03-13-006  Eclipse PCM Reprogramming (420A Engine)	1996 Eclipse 2.0L DOHC 420A A/T	04887050	MIT992012
	1996 Eclipse 2.0L DOHC 420A M/T	04887051	MIT992012

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-04-13-003  PCM Reprogramming for High Speed Misfire (DTC P0300 – P0306)	2003 Eclipse/Eclipse Spyder 3.0L VI M/T	MR988513	975615	VN03101
	2003 Eclipse/Eclipse Spyder 3.0L VI A/T	MR988514	ENG: 875516 A/T: 857108	VN03102
	2004 Eclipse/Eclipse Spyder 3.0L VI M/T	MN132956	944411	VN03103
	2004 Eclipse/Eclipse Spyder 3.0L VI A/T	MN132950	ENG: 844611 A/T: 889402	VN03104

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-05-13-010  PCM Reprogramming for DTC P0300/P0303, P0116, P0131/P0151, P0133/P0153, and P2100	2006 Eclipse V6	1860A219 (M/T) 1860A220 (A/T)	1860A219EE (M/T)  1860A220EA or 1860A220EB (A/T)	1862A437 (M/T) 1862A438 (A/T)
	2006 Eclipse 2.4L	1860A217 (M/T) 1860A218 (A/T)	1860A217BB (M/T)  1860A218BA or 860A218BB (A/T)	1862A435 (M/T) 1862A436 (A/T)

TSB Number	Affected Vehicle	PCM PART NUMBER DISPLAYED	LATEST ROM ID	MUT-III Database
TSB-06-13-005 Freeze-frame data for misfire condition	2006 Eclipse 3.8L A/T	1860A220	1860A220FC	1862A557
	2006 Eclipse 3.8L M/T	1860A219	1860A219FF	1862A556
	2006 Eclipse 2.4L M/T	1860A217	1860A217CC	1862A554
	2006 Eclipse 2.4L A/T	1860A218	1860A218CC	1862A553
	2005 Eclipse/Eclipse Spyder 3.0L VI A/T	MN180604	866209	VN06027
	2005 Eclipse/Eclipse Spyder 3.0L A/T	MN180603	866110	VN06026
	2005 Eclipse/Eclipse Spyder 3.0L VI M/T	MN180602	966009	VN06025
	2005 Eclipse/Eclipse Spyder 3.0L M/T	MN180601	965909	VN06024
	2005 Eclipse/Eclipse Spyder 2.4L M/T	MN191006	970906	VN06023
	2005 Eclipse/Eclipse Spyder 2.4L A/T	MN191008	870706	VN06022
	2005 Eclipse RS 2.4L A/T	MN191007	870606	VN06021

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-06-13-006 PCM Reprogramming for DTC P0335/P0340	2007 Eclipse 2.4L MIVEC A/T	8631A301	8631A301BA	1862A568
	2007 Eclipse/Eclipse Spyder 3.8L MIVEC A/T	8631A149	8631A149BA	1862A567
	2007 Eclipse Spyder 2.4L MIVEC A/T	8631A148	8631A148BA	1862A566
	2007 Eclipse/Eclipse Spyder 3.8L MIVEC M/T	1860A516	1860A516BB	1862A565
	2007 Eclipse/Eclipse Spyder 2.4L MIVEC M/T	1860A515	1860A515BB	1862A564
	2006 Eclipse 3.8L A/T	1860A220	1860A220FC	1862A557
	2006 Eclipse 3.8L MIVEC M/T	1860A219	1860A219FF	1862A556
	2006 Eclipse 2.4L MIVEC M/T	1860A217	1860A217CC	1862A554
	2006 Eclipse 2.4L MIVEC A/T	1860A218	1860A218CC	1862A553

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-98-13-013REV DTC P0120 PCM Reprogramming	1999 Galant V6 (Original data- base # has been updated for TSB-02-13-015)	MD355249 MD355248	204318 204121	VN0301U VN0301T
	1999 Galant 4-cylinder	FED: MD355245 CA: MD355244	206422 206122	VN03014 VN03013

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-99-13-005 PCM Reprogramming For Engine Stall	1999 Galant 2.4L	FED: MD355245 (Eng) MD355244 (A/T) CA: MD355244 (Eng) MD355244 (A/T)	206425 217914  206125 217914	VN0301C VN0301B  VN0301B VN0301B

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-99-23-001 PCM Reprogramming For Harsh 3-2 Downshift	1999 Galant 2.4L	FED: MD355245 (Eng) MD355244 (A/T) CA: MD355244 (Eng) MD355244 (A/T)	206425 217914  206125 217914	VN0301C VN0301B  VN0301B VN0301B

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-02-13-017  PCM Reprogramming For Misfire Code Set with No Driveability Concerns (2.4L 4-cylinder engine)	2002 Galant A/T	MR578505	886012 (ENG) 853903 (A/T)	VN0302K

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-04-13-010  PCM Reprogramming for Engine Pinging at Low Speeds	2004 Galant Fed emissions	1860A226	B43028	VN0407D
	2004 Galant Fed emissions	MN147173	Eng: B43027 A/T: B74510	VN0407B
	2004 Galant Calif emissions	1860A225	B48822	VN0407C
	2004 Galant Calif emissions	MN156501	Eng: B48821 A/T: B73015	VN0407A

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-05-13-005  PCM Reprogramming for DTC P0174	2004 Galant V6	MN132982	Eng: B45815 A/T: B73712	VN0411F

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-05-13-010  PCM Reprogramming for DTC P0300/P0303, P0116, P0131/P0151, P0133/P0153, and P2100	2005 Galant 2.4L - Calif.	1860A057	365822 (ENG) 302903 (A/T)	VN05082
	2005 Galant 2.4L - Federal	1860A056	365722 (ENG) 302803 (A/T)	VN05081
	2005 Galant V6	1860A058	365614 (ENG) 303004 (A/T)	VN05083
	2006 Galant 2.4L - Calif.	1860A316	1860A316BA	1862A440
	2006 Galant 2.4L - Federal	1860A315	1860A315BA	1862A439
	2006 Galant V6	1860A314	1860A314CA	1862A441

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-06-13-002 PCM Reprogramming for DTC P1540/P1541	2006 Galant 2.4L MIVEC Calif. emissions	1860A316	1860A316CA	1862A552



<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-06-13-005 Freeze-frame data for misfire condition	2006 Galant 2.4L Calif. Emis.	1860A316	1860A316CA	1862A552
	2006 Galant 3.8L Federal Emis.	1860A314	1860A314DA	1862A555
	2006 Galant 2.4L Federal Emis.	1860A315	1860A315CA	1862A551
	2005 Galant 3.8L Federal Emis.	1860A058	365615	VN0602L
	2005 Galant 2.4L Federal Emis.	1860A056	365723	VN0602J
	2005 Galant 2.4L Calif. Emis.	1860A057	365823	VN0602I

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-06-13-006 PCM Reprogramming for DTC P0335/P0340	2006 Galant 2.4L MIVEC A/T Calif. emissions	1860A316	1860A316CA	1862A552
	2006 Galant 2.4L MIVEC A/T Federal emissions	1860A315	1860A315CA	1862A551

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-06-13-007 PCM Reprogramming for DTC P0134/P0154	2006 Galant 2.4L MIVEC A/T Calif. emissions	1860A316	1860A316CA	1862A552

TSB Number	Affected Vehicle	PCM P/N	LATEST ROM ID		MUT-III Database
			Engine ROM ID	A/T ROM ID	
<b>TSB-05-13-004REV</b>	2005 Eclipse	MN180603	866109	898602	VN0411B
PCM Reprogramming for Cold Engine	2004 Eclipse	MN132951	844712	889503	VN0411A
Misfire / Hot Soak Restart / Rough Idle	2003 Eclipse/Eclipse Spyder	MR578714	809407	868505	VN04119
	2002 Eclipse Spyder	MR578377	888613	861803	VN0411E
	2002 Eclipse	MR578376	888413	862006	VN04118
	2001 Eclipse Spyder	MR560540	881312	851201	VN0411D
<b>ON 1999-01 GALANTS, SPARK PLUG REPLACE- MENT MAY BE REQUIRED.</b>	2001 Eclipse Spyder	MD367859	245831	-	VN0411C
	2001 Eclipse	MR507645	867113	838408	VN04117
	2001 Eclipse Spyder (MT)	MD367858	245729	-	VN0302X
<b>ON 2000-04 ECLIPSE/ ECLIPSE SPYDERS, THERMOSTAT VALVE REPLACEMENT MAY BE REQUIRED. *</b>	2001 Eclipse Spyder (MT)	MR507904	978008	-	VN0302Z
	2001 Eclipse (MT)	MR507644	967211	-	VN03032
	2002 Eclipse Spyder (MT)	MR578380	988711	-	VN03034
	2002 Eclipse (MT)	MR578379	988511	-	VN03036
	2003 Eclipse (MT)	MR578713	909505	-	VN03038
	2000 Eclipse (4AT)	MD365886	218227	-	VN0302S
	2000 Eclipse (MT)	MD365881	218027	-	VN0302U
	2000 Eclipse (4AT)	MD365886	261303	-	VN0302T
	2000 Eclipse (MT)	MD365881	261003	-	VN0302V
	2000 Eclipse (4AT)	MD365889	218323	-	VN03022
	2000 Eclipse (MT)	MD365883	218123	-	VN03024
	2000 Eclipse (4AT)	MD365889	261401	-	VN03023
	2000 Eclipse (MT)	MD365883	261101	-	VN03025
	2003 Galant	MR578712	809306	869602	VN04116
	2002 Galant	MN132547	827002	878800	VN04115
	2002 Galant	MR578375	871011	841408	VN04114
	2001 Galant	MR514023	877908	846405	VN04113
	2000 Galant	MD365885	245628	-	VN0301V
	2000 Galant	MD365888	245925	-	VN0301W
	1999 Galant	MD355248	204121	-	VN0301T
	1999 Galant	MD355249	204318	-	VN0301U

\* On 2000-2004 Eclipse/Eclipse Spyders with engine number PS5961, first check on the Warranty Superscreen to verify the engine number and confirm whether the thermostat valve was already replaced.

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-05-13-010  PCM Reprogramming for DTC P0300/P0303, P0116, P0131/P0151, P0133/P0153, and P2100	2004.5 Endeavor 2WD	MN156921	B56110 (ENG) B96502 (A/T)	VN05071
	2004.5 Endeavor 4WD	MN156922	B56210 (ENG) B96602 (A/T)	VN05072
	2005 Endeavor 2WD	1860A059	366818 (ENG) 302503 (A/T)	VN05073
	2005 Endeavor 4WD	1860A060	366918 (ENG) 302603 (A/T)	VN05074
	2006 Endeavor 2WD	1860A293	381906 (ENG) 309805 (A/T)	VN05084
	2006 Endeavor 4WD	1860A294	382006 (ENG) 309904 (A/T)	VN05085

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-05-13-002  PCM Reprogramming for Spark Knock / Engine Pinging / MFI DTCs / Delayed A/T Shift	2005 Endeavor 4WD	1860A060	ENG: 366916 A/T: 302603	VN5016
	2005 Endeavor 2WD	1860A059	ENG: 366816 A/T: 302503	VN05015
	2004 Endeavor 4WD	MN156922	ENG: B56209 A/T: B96602	VN05014
	2004 Endeavor 4WD	MN132653	ENG: B88157 A/T: B64533	VN05012
	2004 Endeavor 2WD	MN132652	ENG: B87657 A/T: B64432	VN05011
	2004 Endeavor 2WD	MN156921	ENG: B56109 A/T: B96502	VN05013

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-06-13-005 Freeze-frame data for misfire condition	2006 Endeavor 4WD	1860A294	382008	VN0601C
	2006 Endeavor 2WD	1860A293	381908	VN0601B
	2005 Endeavor 4WD	1860A060	366919	VN0602N
	2005 Endeavor 2WD	1860A059	366819	VN0602M

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-03-13-009  PCM Reprogramming for DTC P0507	2002 Lancer M/T Calif.	MR578518	986712	VN03071
	2002 Lancer A/T Calif. OZ-Rally & LS	ENG: MR578520 A/T: MR578520	ENG: 885413 A/T: 852606	VN03073
	2002 Lancer A/T Calif. ES	ENG: MR578489 A/T: MR578489	ENG: 898913 A/T: 864104	VN03072
	2002 Lancer M/T Federal	MR578519	987212	VN03074
	2002 Lancer A/T Federal OZ-Rally & LS	ENG: MR578521 A/T: MR578521	ENG: 885613 A/T: 852806	VN03075
	2002 Lancer A/T Federal ES	ENG: MR578490 A/T: MR578490	ENG: 899013 A/T: 864204	VN03076
	2003 Lancer M/T Calif.	MR988327	918608	VN03077
	2003 Lancer A/T Calif. OZ- Rally & LS	ENG: MR988328 A/T: MR988328	ENG: 818708 A/T: 874902	VN03078
	2003 Lancer A/T Calif. ES	ENG: MR988329 A/T: MR988329	ENG: 818808 A/T: 875002	VN03079
	2003 Lancer M/T Federal	MR988330	918908	VN0307A
	2003 Lancer A/T Federal OZ- Rally & LS	ENG: MR988331 A/T: MR988331	ENG: 819008 A/T: 875102	VN0307B
	2003 Lancer A/T Federal ES	ENG: MR988332 A/T: MR988332	ENG: 819108 A/T: 875202	VN0307C

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
EMR-05-001REVII  Catalytic Converter Overheating -Emissions Recall	2002 Lancer M/T Fed. emissions	MR578519	987220	VN0510A
	2002 Lancer A/T Fed. emissions R15 tires	Eng: MR578521 A/T: MR578521	Eng: 885621 A/T: 852806	VN0510B
	2002 Lancer A/T Fed. emissions R14 tires	Eng: MR578490 A/T: MR578490	Eng: 899021 A/T: 864204	VN0510C
	2002 Lancer M/T Calif. emissions	MR578518	986720	VN0510G
	2002 Lancer A/T Calif. emissions R15 tires	Eng: MR578520 A/T: MR578520	Eng: 885421 A/T: 852606	VN0510H
	2002 Lancer A/T Calif. emissions R14 tires	Eng: MR578489 A/T: MR578489	Eng: 898921 A/T: 864104	VN0510I
	2003 Lancer M/T Fed. emissions	MR988330	918915	VN05107
	2003 Lancer A/T Fed. emissions R15 tires	Eng: MR988331 A/T: MR988331	Eng: 819016 A/T: 875102	VN05108
	2003 Lancer A/T Fed. emissions R14 tires	Eng: MR988332 A/T: MR988332	Eng: 819116 A/T: 875202	VN05109
	2003 Lancer M/T Calif. emissions	MR988327	918616	VN0510D
	2003 Lancer A/T Calif. emis- sions R15 tires	Eng: MR988328 A/T: MR988328	Eng: 818717 A/T: 874902	VN0510E
	2003 Lancer A/T Calif. emis- sions R14 tires	Eng: MR988329 A/T: MR988329	Eng:818817 A/T:875002	VN0510F
	2004 Lancer M/T	MN132864	922923	VN05104
	2004 Lancer A/T R15 tires	Eng: MN132867 A/T: MN132867	Eng:823024 A/T:876903	VN05105
2004 Lancer A/T R14 tires	Eng:MN132868 A/T: MN132868	Eng:823124 A/T:877001	VN05106	

	2005 Lancer M/T	1860A067	966314	VN05101
	2005 Lancer A/T R15 tires	Eng: 1860A068 A/T: 1860A068	Eng:866414 A/T:802302	VN05102
	2005 Lancer A/T R14 tires	Eng:1860A069 A/T: 1860A069	Eng:866514 A/T:802402	VN05103
	2006 Lancer M/T	1860A417	882512	VN05091
	2006 Lancer A/T R15 tires	Eng:1860A418 A/T:1860A418	Eng:882612 A/T:812502	VN05092
	2006 Lancer A/T R14 tires	Eng:1860A419 A/T:1860A419	Eng:882712 A/T:812601	VN05093

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
EMR-05-002  PCM Reprogramming for VSS Malfunction -Emissions Recall	2005 Lancer 2.4L M/T	1860A070	C71319	VN05063

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-05-55-004  Insufficient Heater Performance	2002 Lancer M/T Fed. emissions	MR578519	987220	VN0510A
	2002 Lancer A/T Fed. emissions R15 tires	Eng: MR578521 A/T: MR578521	Eng: 885621 A/T: 852806	VN0510B
	2002 Lancer A/T Fed. emissions R14 tires	Eng: MR578490 A/T: MR578490	Eng: 899021 A/T: 864204	VN0510C
	2002 Lancer M/T Calif. emissions	MR578518	986720	VN0510G
	2002 Lancer A/T Calif. emissions R15 tires	Eng: MR578520 A/T: MR578520	Eng: 885421 A/T: 852606	VN0510H

2002 Lancer A/T Calif. emissions R14 tires	Eng: MR578489 A/T: MR578489	Eng: 898921 A/T: 864104	VN0510I
2003 Lancer M/T Fed. emissions	MR988330	918915	VN05107
2003 Lancer A/T Fed. emissions R15 tires	Eng: MR988331 A/T: MR988331	Eng: 819016 A/T: 875102	VN05108
2003 Lancer A/T Fed. emissions R14 tires	Eng: MR988332 A/T: MR988332	Eng: 819116 A/T: 875202	VN05109
2003 Lancer M/T Calif. emissions	MR988327	918616	VN0510D
2003 Lancer A/T Calif. emissions R15 tires	Eng: MR988328 A/T: MR988328	Eng: 818717 A/T: 874902	VN0510E
2003 Lancer A/T Calif. emissions R14 tires	Eng: MR988329 A/T: MR988329	Eng:818817 A/T:875002	VN0510F
2004 Lancer M/T	MN132864	922923	VN05104
2004 Lancer A/T R15 tires	Eng: MN132867 A/T: MN132867	Eng:823024 A/T:876903	VN05105
2004 Lancer A/T R14 tires	Eng:MN132868 A/T: MN132868	Eng:823124 A/T:877001	VN05106
2005 Lancer M/T	1860A067	966314	VN05101
2005 Lancer A/T R15 tires	Eng: 1860A068 A/T: 1860A068	Eng:866414 A/T:802302	VN05102
2005 Lancer A/T R14 tires	Eng:1860A069 A/T: 1860A069	Eng:866514 A/T:802402	VN05103
2006 Lancer M/T	1860A417	882512	VN05091
2006 Lancer A/T R15 tires	Eng:1860A418 A/T:1860A418	Eng:882612 A/T:812502	VN05092
2006 Lancer A/T R14 tires	Eng:1860A419 A/T:1860A419	Eng:882712 A/T:812601	VN05093

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-06-13-005 Freeze-frame data for misfire condition	2005 Lancer 2.0L MIVEC M/T	1860A070	C71320	VN0602D
	2005 Lancer/ Lancer Sportback 2.0L MIVEC A/T	1860A071	E71218	VN0602C
	2005 Lancer 2.4L M/T	1860A067	966315	VN0602B
	2005 Lancer 2.4L A/T w/R14 tires	1860A069	866515	VN0602A
	2005 Lancer 2.4L A/T w/R15 tires	1860A068	866415	VN06029
	2006 Lancer 2.4L MIVEC M/T	1860A420	C82810	VN06016
	2006 Lancer/Lancer Sportback 2.4L MIVEC A/T	1860A421	E82911	VN06015
	2006 Lancer 2.0L M/T	1860A417	882513	VN06014
	2006 Lancer 2.0L A/T w/R14 tires	1860A419	882713	VN06013
	2006 Lancer 2.0L A/T w/R15 tires	1860A418	882613	VN06012

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-06-13-006 PCM Reprogramming for DTC P0335/P0340	2006 Lancer 2.4L MIVEC M/T	1860A420	C82810	VN06016
	2006 Lancer/Lancer Sportback 2.4L MIVEC A/T	1860A421	E82911	VN06015
	2005 Lancer 2.4L MIVEC M/T	1860A070	C71320	VN0602D

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-06-13-007 PCM Reprogramming for DTC P0134/P0154	2006 Lancer 2.4L MIVEC M/T	1860A420	C82810	VN06016
	2006 Lancer/Lancer Sportback 2.4L MIVEC A/T	1860A421	E82911	VN06015



<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-05-13-003	2004 Lancer Evolution	MN191022	964111	VN04122
PCM Reprogramming for DTC P0300 Random Misfire	2003 Lancer Evolution	MN132874	941715	VN04121

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-06-13-005	2005 Lancer Evolution	1860A118	969313	VN06028
Freeze-frame data for misfire condition	2006 Lancer Evolution	1860A465	885915	VN06011

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-99-13-007 PCM Reprogramming For Engine Surge / Cold Start / DTC P0120	1999 Mirage 1.5L	FED: MR507121	235007	VN0302D
		CA: MR507120	235106	VN0302C
	1999 Mirage 1.8L	FED: MD359597	235206	VN0302F
		CA: MD359596	235305	VN0302E
	1998 Mirage 1.5L	FED: MR507119	215509	VN0302G
		CA: MR507118	207611	VN0302H

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-01-23-007REV	2001 Montero 5-speed A/T	MR507699	856217	VN0211I
PCM Reprogramming For 2-3 Shift Flare	2001 Montero 4-speed A/T	MR514089	872316	VN0211G

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-04-13-011  PCM Reprogramming for DTC P0125	2004 Montero	MN153500	Eng: B50015 A/T: B93303	VN4079
	2003 Montero	MN132637	Eng: B91843 A/T: B73212	VN4077
	2003 Montero	MN132636	Eng: B14943 A/T: B73308	VN4076
	2002 Montero sold in Puerto Rico	MR578464	Eng: B99210 A/T: B62602	VN4075
	2002 Montero	MR578176	Eng: B88216 A/T: B55705	VN4074
	2001 Montero sold in Puerto Rico	MR514089	Eng: B872320 A/T: 840806	VN4073
	2002 Montero sold in Puerto Rico	MR507700	Eng: 865420 A/T: 836911	VN4072
	2001 Montero <b>REPLACE HEATED OXYGEN SENSORS</b>	MR507699	Eng: 856221 A/T: 828217	VN4071

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
TSB-05-13-008  PCM Reprogramming for DTC P0134	2004 Montero	MN153500	Eng: B50015 A/T: B93303	VN4079
	2003 Montero	MN132637	Eng: B91843 A/T: B73212	VN4077
	2003 Montero	MN132636	Eng: B14943 A/T: B73308	VN4076
	2002 Montero sold in Puerto Rico	MR578464	Eng: B99210 A/T: B62602	VN4075
	2002 Montero	MR578176	Eng: B88216 A/T: B55705	VN4074

TSB Number	Affected Vehicle	PCM PART NUMBER DISPLAYED	LATEST ROM ID	MUT-III Database
TSB-05-13-009REV PCM Reprogramming for DTC P0125	2001 Montero	MR507699	Eng: 856221 A/T: 828217	VN04071
	2001 Montero sold in Puerto Rico	MR514089	Eng: 872320 A/T: 840806	VN04073
	2001 Montero sold in Puerto Rico	MR507700	Eng: 865420 A/T: 836911	VN04072

TSB Number	Affected Vehicle	PCM P/N or Hardware P/N	LATEST ROM-ID or Software P/N	MUT-III Database
TSB-06-13-005 Freeze-frame data for misfire condition	2005 Montero	1860A014	364818	VN0602K
	2006 Montero	8631A201	392005	VN05121

TSB Number	Affected Vehicle	PCM PART NUMBER DISPLAYED	ROM ID (for reference only)	LATEST ROM ID	MUT-III Database
SR-99-001 A/T Overheating Safety Recall Campaign  <b>REQUIRES INSTALLATION OF BREATHER HOSE REPAIR KIT</b>	1999 Montero Sport 3.0L	FED: MD357515 (M/T) MD357513(A/T) CA: MD357513 (M/T) MD357513(A/T)	229310 (Eng) 218418 (A/T) 229111 (Eng) 218418 (A/T)	229313 218419 229114 218419	VN04041 VN0212B VN04011 VN0212B
	1999 Montero Sport 3.5L FED produced before 9/7/98	MD357516 (Eng) MD357514 (A/T)	229508 (Eng) 228106 (A/T)	229510 228107	VN04042 VN0211Q
	1999 Montero Sport 3.5L FED produced after 9/7/98	MD364531 (Eng) MD364530 (A/T)	244602 (Eng) 218517 (A/T)	244604 218518	VN04043 VN0211R
	1999 Montero Sport 3.5L CA produced before 9/18/98	MD357514 (Eng) MD357514 (A/T)	229409 (Eng) 228106 (A/T)	229412 228107	VN04012 VN0211Q
	1999 Montero Sport 3.5L CA produced after 9/18/98	MD364530 (Eng) MD364530 (A/T)	244502 (Eng) 218517 (A/T)	244505 218518	VN04044 VN0211R

TSB Number	Affected Vehicle	PCM PART NUMBER DISPLAYED	LATEST ROM ID	MUT-III Database
TSB-01-23-007REV  PCM Reprogramming For 2-3 Shift Flare	1999 Montero Sport 3.0L	FED: MD357515 (Eng) MD357513 (A/T) CA: MR357513	229310 (Eng) 218419 (A/T)  229111 (Eng) 218419 (A/T)	VN0212D VN0212B  VN0212B
	1999 Montero Sport 3.5L Fed with Diff. Red. Ratio 4.272	MD357516 (Eng) MD357514 (A/T)	229508 (Eng) 228107 (A/T)	VN0211S VN0211Q
	1999 Montero Sport 3.5L CA with Diff. Red. Ratio 4.272	MD357514	229409 (Eng) 228107 (A/T)	VN0211Q
	1999 Montero Sport 3.5L Fed with Diff. Red. Ratio 4.636	MD364531 (Eng) MD364530 (A/T)	244602 (Eng) 218518 (A/T)	VN0211T VN0211R
	1999 Montero Sport 3.5L CA with Diff. Red. Ratio 4.636	MD364530	244502 (Eng) 218518 (A/T)	VN0211R
	2000 Montero Sport 3.0L CA 2WD	MD366804	226410	VN0211Y
	2000 Montero Sport 3.0L CA 4WD	MD369099	234505	VN0211Z
	2001 Montero Sport 3.0L 50-state 2WD	MR560347	671308 (Eng) 643809 (A/T)	VN02118
	2000 Montero Sport 3.0L Fed 2WD	MD366806	232805	VN0302I
	2000 Montero Sport 3.0L Fed 4WD	MD369101	234804	VN0302J
	2001 Montero Sport 3.0L 50-state 4WD	MR560348	671410	VN02119
	2000 Montero Sport 3.5L CA 2WD	MD365953	226510	VN02123
	2000 Montero Sport 3.5L CA 4WD	MD369100	234604	VN02125
	2001 Montero Sport 3.5L 50-state 2WD	MR560349	671508	VN02111

	2000 Montero Sport 3.5L Fed 2WD	MD369102	234704	VN0211P
	2001 Montero Sport 3.5L Fed 4WD	MD365954	232705	VN02124
	2001 Montero Sport 3.5L 50-state 4WD	MR560350	671609	VN02112

TSB Number	Affected Vehicle	PCM PART NUMBER DISPLAYED	ROM ID (for reference only)	LATEST ROM ID	MUT-III Database
TSB-02-13-019  PCM Reprogramming For DTC P0154 (3.5L engine)  <b>ALSO REQUIRES LEFT REAR O2 SENSOR REPLACEMENT</b>	1999 Montero Sport	MD357514	229410	229412	VN04012
	1999 Montero Sport	MD364530	244503	244505	VN04044
	1999 Montero Sport	MD357516	229508	229510	VN04042
	1999 Montero Sport	MD364531	244602	244604	VN04043
	2000 Montero Sport	MD365953	250509	250512	VN04015
	2000 Montero Sport	MD369100	261909	261912	VN04016
	2000 Montero Sport	MD365953	226510		
	2000 Montero Sport	MD369100	234604		
	2000 Montero Sport	MD365954	232705	250608	VN04047
	2000 Montero Sport	MD369102	234704	262008	VN04048
	2001 Montero Sport	MR560349	671509	671514	VN04019
	2001 Montero Sport	MR560350	671609	671614	VN0401A

TSB Number	Affected Vehicle	PCM PART NUMBER DISPLAYED	LATEST ROM ID	MUT-III Database
TSB-04-13-002REV  PCM Reprogramming For Engine Hesitation and/or DTC P0154  <b>MAY REQUIRE LEFT REAR O2 SENSOR REPLACEMENT</b>	2003 Montero Sport 3.5L 4WD	MR578353	ENG: B15506 A/T: B62403	VN0401I
	2003 Montero Sport 3.5L 2WD	MR578352	ENG: B15406 A/T: B62302	VN0401H
	2003 Montero Sport 3.0L 4WD	MR578351	ENG: B15306 A/T: B62202	VN0401G
	2003 Montero Sport 3.0L 2WD	MR578350	ENG: B15206 A/T: B62102	VN0401F
	2002 Montero Sport 3.5L 4WD	MR578045	ENG: B90911 A/T: B57507	VN0401E
	2002 Montero Sport 3.5L 2WD	MR578044	ENG: B90811 A/T: B57409	VN0401D
	2002 Montero Sport 3.0L 4WD	MR578043	ENG: B91510 A/T: B57307	VN0401C
	2002 Montero Sport 3.0L 2WD	MR578042	ENG: B91410 A/T: B57207	VN0401B
	2001 Montero Sport 3.5L 4WD	MR560350	ENG: 671614 A/T: 644111	VN0401A

2001 Montero Sport 3.5L 2WD	MR560349	ENG: 671514 A/T: 644008	VN04019
2001 Montero Sport 3.0L 4WD	MR560348	ENG: 671414 A/T: 643910	VN04018
2001 Montero Sport 3.0L 2WD	MR560347	ENG: 671314 A/T: 643809	VN04017
2000 Montero Sport Calif. 3.5L 4WD	MD369100	261912	VN04016
2000 Montero Sport Calif. 3.5L 2WD	MD365953	250512	VN04015
2000 Montero Sport Calif. 3.0L 4WD	MD369099	262111	VN04014
2000 Montero Sport Calif. 3.0L 2WD	MD366804	252911	VN04013
1999 Montero Sport Calif. 3.5L 2WD	MD357514	229412	VN04012
1999 Montero Sport Calif. 3.0L 2WD/4WD	MD357513	229114	VN04011
2000 Montero Sport 3.0L 4WD Puerto Rico	MD369103	262308	VN0404A
2000 Montero Sport 3.0L 2WD Puerto Rico	MD365179	253108	VN04049
2000 Montero Sport 3.5L 4WD	MD369102	262008	VN04048
2000 Montero Sport 3.5L 2WD	MD365954	250608	VN04047
2000 Montero Sport 3.0L 4WD	MD369101	262208	VN04046
2000 Montero Sport 3.0L 2WD	MD366806	253008	VN04045
1999 Montero Sport 3.5L 4WD Calif.	MD364530	244505	VN04044
1999 Montero Sport 3.5L 4WD Fed.	MD364531	244604	VN04043
1999 Montero Sport 3.5L 2WD/4WD	MD357516	229510	VN04042
1999 Montero Sport 3.0L	MD357515	229313	VN04041

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM PART NUMBER DISPLAYED</b>	<b>LATEST ROM ID</b>	<b>MUT-III Database</b>
SR-03-001 / TSB-04-13-005	2003 Outlander 2WD	MN122009	804321	VN04021
Throttle Icing Condition - Safety Recall Campaign	2003 Outlander 4WD	MN122010	804422	VN04022

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
EMR-05-002	2005 Outlander 2.4L M/T 2WD	1860A148	C71419	VN05061
PCM Reprogramming for VSS Malfunction -Emissions Recall	2005 Outlander 2.4L M/T 4WD	1860A149	C71519	VN05062

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-06-13-005 Freeze-frame data for misfire condition	2005 Outlander M/T AWD	1860A149	C71520	VN0602H
	2005 Outlander M/T 2WD	1860A148	C71420	VN0602G
	2005 Outlander A/T AWD	1860A125	E68615	VN0602F
	2005 Outlander A/T 2WD	1860A151	E68515	VN0602E
	2006 Outlander M/T AWD	1860A473	C84611	VN0601A
	2006 Outlander M/T 2WD	1860A472	C84511	VN06019
	2006 Outlander A/T AWD	8631A118	E84810	VN06018
	2006 Outlander A/T 2WD	8631A117	E84710	VN06017



<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-06-13-006 PCM Reprogramming for DTC P0335/P0340	2006 Outlander 2.4L MIVEC M/T 4WD	1860A473	C84611	VN0601A
	2006 Outlander 2.4L MIVEC M/T 2WD	1860A472	C84511	VN06019
	2006 Outlander 2.4L MIVEC A/T 4WD	8631A118	E84810	VN06018
	2006 Outlander 2.4L MIVEC A/T 2WD	8631A117	E84710	VN06017
	2005 Outlander 2.4L MIVEC M/T 4WD	1860A149	C71520	VN0602H
	2005 Outlander 2.4L MIVEC M/T 2WD	1860A148	C71420	VN0602G

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>	<b>LATEST ROM-ID or Software P/N</b>	<b>MUT-III Database</b>
TSB-06-13-007 PCM Reprogramming for DTC P0134/P0154	2006 Outlander 2.4L MIVEC M/T 4WD	1860A473	C84611	VN0601A
	2006 Outlander 2.4L MIVEC M/T 2WD	1860A472	C84511	VN06019
	2006 Outlander 2.4L MIVEC A/T 4WD	8631A118	E84810	VN06018
	2006 Outlander 2.4L MIVEC A/T 2WD	8631A117	E84710	VN06017

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>PCM P/N or Hardware P/N</b>
TSB-06-23-001 Low torque in reverse DTC P1713/P1776	2006 Raider 3.7L and 42RLE A/T	05094056AG

<b>TSB Number</b>	<b>Affected Vehicle</b>	<b>CCN P/N</b>
SR-06-002 CCN Module reprogramming - Safety Recall	2006 Raider models produced before 2/3/06	05094056AG